

**Report Number : DELF20007009-A**



**Intertek India Private Limited**

290, Udyog Vihar, Phase-II, Gurgaon, Haryana -122016.  
Tel : 0124-4503400, Fax : 0124-4303592.

Registered Office : E-20, Block B-1, Mohan Co-Operative Industrial Area, Mathura Road, New Delhi -110044. Web site : [www.intertek.com](http://www.intertek.com).

**TEST REPORT**

NABL Cert.No:TC-5663  
ULR - TC-566320320007009P

**NUMBER : DELF20007009-A**  
**DATE : 05-Oct-2020**

Sample Description : THE SUMMITTED SAMPLE SAID TO BE FABRIC SWATCH IN  
COLOR MARKED AS BLACK (LAB IDENTIFIED).  
Date Received/date Test Started : 23 Sep 2020  
Date Confirmation Received : 24 Sep 2020  
Buyer : NOT PROVIDED  
P.O.No : -  
Fiber Content :  
Style :  
Color : NOT PROVIDED  
Article No :

---

**TEST CONDUCTED : AS PER THE REQUEST OF THE APPLICANT. FOR FURTHER DETAILS PLEASE  
REFER TO ENCLOSED PAGE(S)**

---

**CONCLUSION :**


Martindale Abrasion	M
Tear Resistance	M
Tensile Strength	M

**NOTE:**

M = MEETS REQUIREMENT,	F = FAILS TO MEET REQUIREMENT
* = REQUIREMENT NOT PROVIDED,	NA = NOT APPLICABLE
# = EXEMPTED,	NC = NO COMMENT,
SC = SEE COMMENT	** = REFER RESULT
## = NOT PERFORMED	MA = MARGINAL ACCEPTANCE
NR = NOT REQUESTED	D = DATA ONLY
C=CONFIRM LABEL	

**Specification For Testing Has Been Provided By The Applicant.**

AUTHORIZED BY  
FOR Intertek India Private Limited [Footwear]

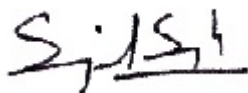

SURJIT SINGH  
DEPUTY MANAGER

**TEST REPORT**NABL Cert.No:TC-5663  
ULR - TC-566320320007009P**NUMBER : DELF20007009-A****DATE : 05-Oct-2020**

TEST CONDUCTED (AS REQUESTED BY THE APPLICANT)

**1. Martindale Abrasion**

- ISO 13520

Dry

		<u>Requirement</u>
After 1600 Rubs	No Wear Observed	-
After 3200 Rubs	No Wear Observed	-
After 6400 Rubs	Very Slight Wear Observed	-
After 12800 Rubs	Slight Wear Observed	Not Worse Than Moderate Wear After 12800 Cycles

**2. Tear Resistance**

- ISO 13571

		<u>Requirement</u>
Direction 1	18.9 N	>15 N
Direction 2	19.9 N	

REMARK:

Direction 2 is Perpendicular To Direction 1

**3. Tensile Strength**

ISO 13934-2 : 2014.

		<u>Requirement</u>
Direction 1:	340 N	>230 N
Direction 2:	486 N	

REMARK:

Direction 2 is Perpendicular To Direction 1

---

**## END OF THE TEST REPORT ##**

*This report is made solely on the basis of your instructions and/or information and materials supplied by you. It is not intended to be a recommendation for any particular course of action. Intertek does not accept a duty of care or any other responsibility to any person other than the Addressee in respect of this report and only accepts liability to the Addressee insofar as is expressly contained in the terms and conditions governing Intertek's provision of services to you. Intertek makes no warranties or representations either express or implied with respect to this report save as provided for in those terms and conditions. We have aimed to conduct the Review on a diligent and careful basis and we do not accept any liability to you for any loss arising out of or in connection with this report, in contract, tort, by statute.*

<http://www.intertek.com/terms>